



# WASP PROTECT

Portal > Knowledgebase > FAQs > Windows Mobile Device Center troubleshooting on Windows 10

---

## Windows Mobile Device Center troubleshooting on Windows 10

Sicaro Burnett - 2020-09-30 - in FAQs

Issue:

Windows Mobile Device Center (WMDC) will not open on Windows 10

Windows Mobile Devices will not show as **Connected** in WMDC when using Windows 10

## Basic Troubleshooting for WMDC on Windows 10

### 1. Download and Install WMDC

The installer for WMDC can be downloaded from the links below:

64bit: <http://dl.waspbarcode.com/kb/wmdc/wmdc-64-bit-drupdate-amd64.exe>

32bit <http://dl.waspbarcode.com/kb/wmdc/wmdc-32-bit-drupdate-x86.exe>

If WMDC does not open after being installed, proceed to the next step.


### 2. Run WMDC\_Service\_Fix.bat

Download the following

[https://dl.waspbarcode.com/kb/wmdc/WMDC\\_Service\\_Fix.bat](https://dl.waspbarcode.com/kb/wmdc/WMDC_Service_Fix.bat)

Right click the file, and choose **Run as Administrator**

If successful, the screen should show the following:

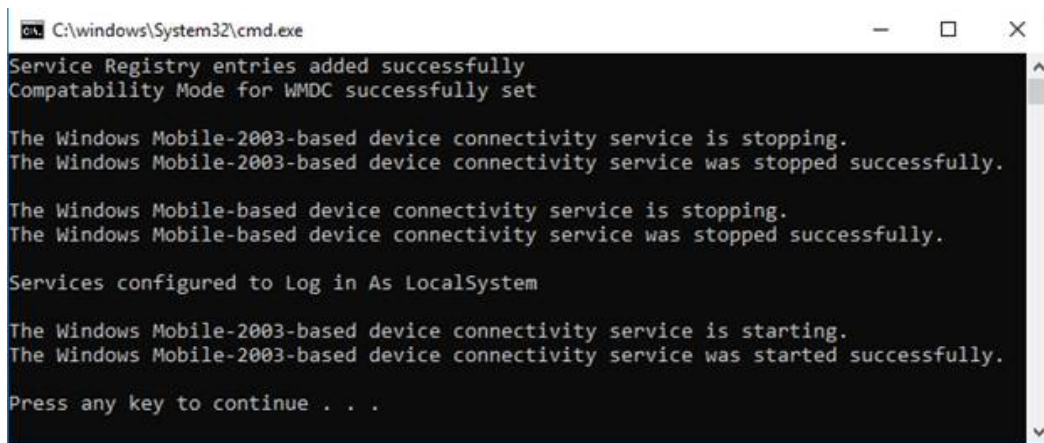

```
C:\windows\System32\cmd.exe
Service Registry entries added successfully
Compatability Mode for WMDC successfully set

The Windows Mobile-2003-based device connectivity service is stopping.
The Windows Mobile-2003-based device connectivity service was stopped successfully.

The Windows Mobile-based device connectivity service is stopping.
The Windows Mobile-based device connectivity service was stopped successfully.

Services configured to Log in As LocalSystem

The Windows Mobile-2003-based device connectivity service is starting.
The Windows Mobile-2003-based device connectivity service was started successfully.

Press any key to continue . . .
```

If your system does not allow running bat files, or if you are concerned about running bat files on your system, there are comments in the file which detail every command being executed.

You can also find instructions to manually change these settings in the following article:

<http://support.waspbarcode.com/kb/articles/1568>

### 3. Verify Connection Settings

Some mobile devices require specific connection settings to connect properly

#### HC1 Connection settings:

<http://support.waspbarcode.com/kb/articles/1018>

#### WDT60 Connection Settings:

<http://support.waspbarcode.com/kb/articles/1099>

(There are no specific connection settings for the WDT90 or WDT92)

### 4. Establish the Mobile Device Connection

Open Windows Mobile Device Center

then plug in the mobile device.

It should install the drivers and, within a few minutes, start showing connecting then connected.



**If the mobile device does not connect, proceed to the next step**

### **5. Thorough Device Removal**

Unplug the device from USB

Follow the steps in the Knowledge Base article below:

<http://support.waspbarcode.com/kb/articles/1229>

Go back to the previous step, and **Establish the Mobile Device Connection**

Occasionally, this step needs to be completed several times before your Mobile Device will connect.

If, after several attempts, it has not connected, proceed to:

**Additional Troubleshooting for WMDC on Windows 10**

---

## **Additional Troubleshooting for WMDC on Windows 10**

### **1. Remove McAfee Live Safe**


McAfee Live Safe interferes with the operation of many mobile devices

<http://support.wasbarcode.com/kb/articles/1050>

If you have Live Safe, or any other protection software mentioned in the above article:  
Using **add/remove programs**, completely uninstall that software

## 2. Verify that .NET 3.5 has been fully installed

Open Control Panel > Programs and Features > Turn Windows features on or off.

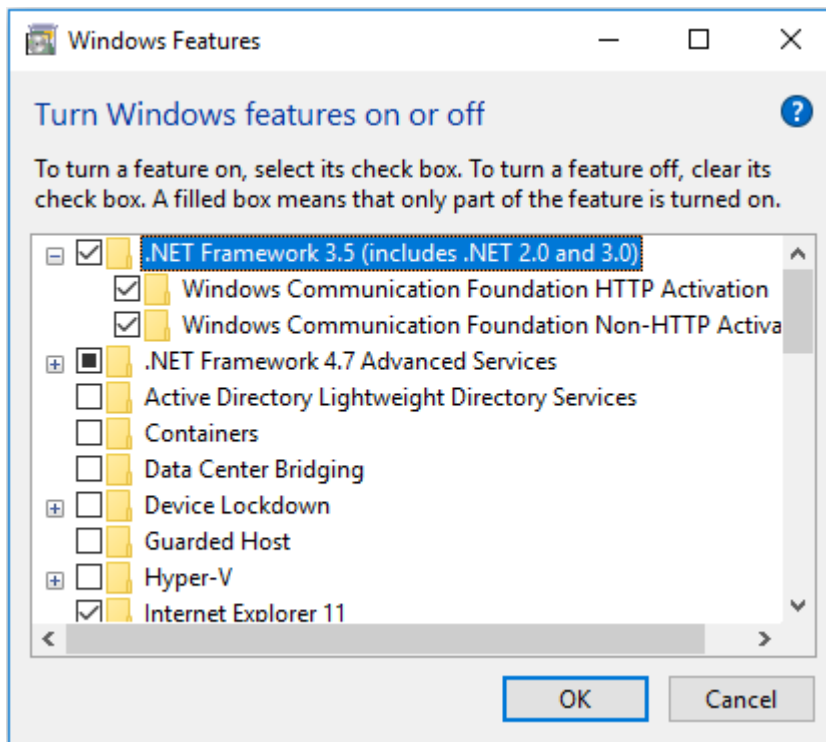

Allow Windows to update the feature.

## 3. Download and run the WMDC-Helper.exe

Download WMDC-Helper.exe from the following:

<https://www.junipersys.com/support/article/12162>

After it has downloaded, right-click it, and select **Run as Administrator**.

## 4. Reboot the PC (Do Not Skip this Step)

## 5. Warm or Cold Boot your Mobile Device

While the PC is rebooting, perform a warm or cold boot depending upon the following:

Is there any data on the device that needs to be kept?

If there is not, then **clean/cold boot** the device.

If there is data that needs to be retained on the device, **warm boot** the device.

## **6. Verify Connection Settings**

Some mobile devices require specific connection settings to connect properly  
*(If a cold/clean boot was performed these settings will need to be applied again)*

### **HC1 Connection settings:**

<http://support.waspbarcode.com/kb/articles/1018>

### **WDT60 Connection Settings:**

<http://support.waspbarcode.com/kb/articles/1099>

(There are no specific connection settings for the WDT90 or WDT92)

## **7. Establish the Mobile Device Connection**

Open Windows Mobile Device Center

then plug in the mobile device.

It should install the drivers and, within a few minutes, start showing connecting then connected.

**If the mobile device does not connect, proceed to the next step**

## **8. Thorough Device Removal**

Unplug the device from USB

Follow the steps in the Knowledge Base article below:

<http://support.waspbarcode.com/kb/articles/1229>


Attempt the previous step again.

## **9. Update the Driver, if Necessary**

In the **Device Manager**, Open the **Other** topic

If you see either **RNDIS** or **Datalogic Serial**,

Right click on that item and choose **Update Driver**

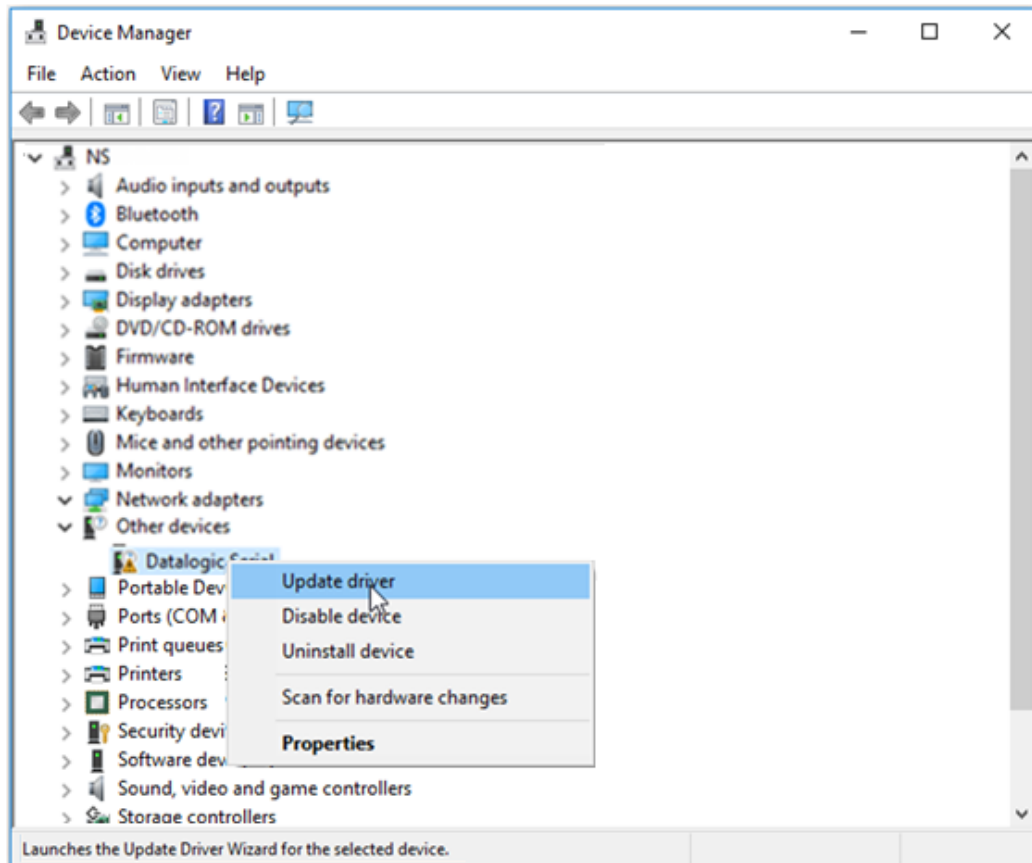

Browse to the following directory:

C:\Windows\Windows Mobile\

Be sure that **Include Subfolders** is checked and select **Next**

This should install the appropriate driver for your mobile device, which will now show as one of the devices listed in the previous step.

Go back and attempt to **Establish the Mobile Device Connection** again

Occasionally, these steps need to be completed several times before your Mobile Device will connect.

If, after several attempts, it has not connected, proceed to:

**Advanced Troubleshooting for WMDC on Windows 10**

---

## Advanced Troubleshooting for WMDC on Windows 10

This section is for more advanced users, if all of the above has failed to resolve the issue.

### **1. Uninstall and Reinstall .NET 3.5**

If .NET errors are contributing to the failure of WMDC, you may need to uninstall and reinstall .NET 3.5

The following article details this process:

<http://support.waspbarcode.com/kb/articles/1285>

### **2. Uninstall and Reinstall WMDC**

In add/remove programs, uninstall all instances of Windows Mobile Device Center and related updates.

You may need to refer to the following if it does not properly uninstall:

<http://support.waspbarcode.com/kb/articles/1346>

### **3. Verify that Microsoft Windows Remote Desktop Connection is not interfering with the WMDC connection**

When using **Microsoft's Windows Remote Desktop Connection** to remote into a PC, no mobile device connected to this PC will show as **Connected** in WMDC. This is a limitation of how Windows Remote Desktop handles USB connections.

If the you must troubleshoot the device using a remote connection, it is recommended to use other remote desktop tools to do so.

### **4. Verify that nothing is interfering with the WMDC connection**

Sometimes, in particularly restrictive systems, there may be other components interfering with the connection.

This may include: Network Settings, Firewalls, Group Policies, or Protection Software. The following article is intended for more advanced users and details some possible solutions:

<http://support.waspbarcode.com/kb/articles/1060>

---

#### Related Pages

- [Windows Mobile Device Center \(WMDC\) Troubleshooting Resources](#)